

Hyattsville Accessibility Transition Plan


St. Matthews Church (Voting Location Ward 4)

5601 36th Avenue



KEY

- Proposed solutions - see red item numbers on the Transition Plan spread sheets that follow this page  or 
- Accessible route 
- Accessible surface at play equipment (approximate area) 

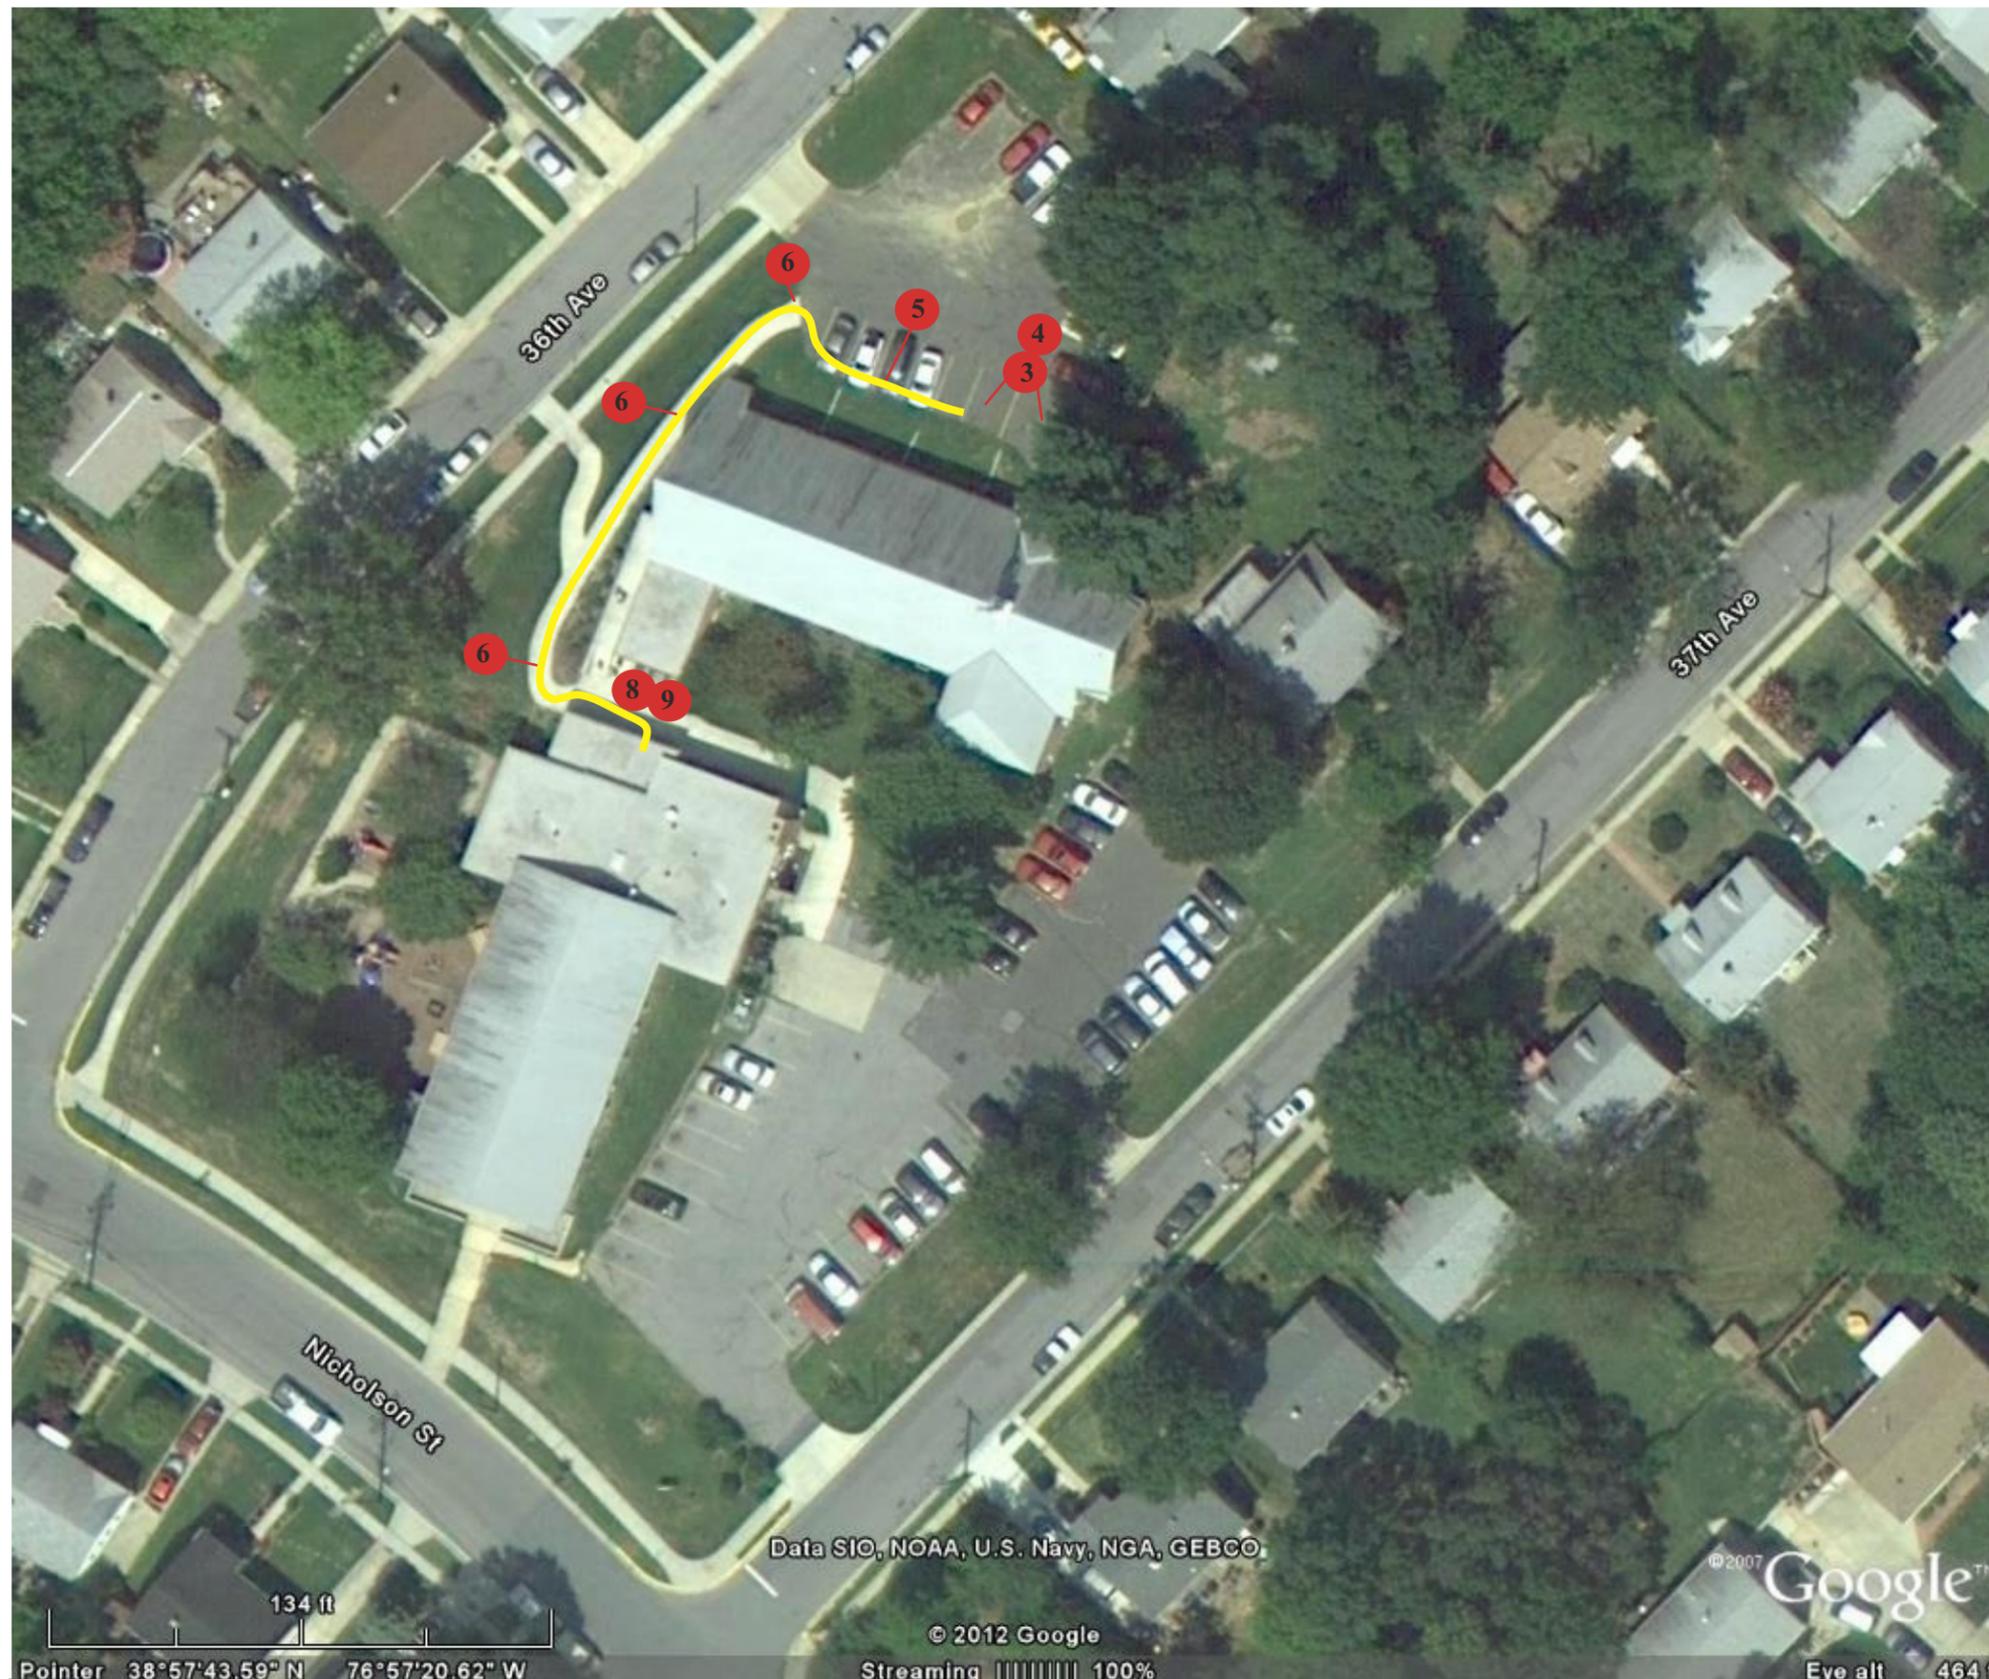

St. Matthew's Church - Ward 4 Voting Location - Hyattsville Transition Plan

Address: 5601 36th Street

2010 Standards Citation	Description/Issue/Requirement	Non-Complying Item	Photos	Proposed Solution	Suggested Priority	Projected Cost Hyattsville	Projected Date	Action and Date
1								
2	Exterior Accessible Route from Front Parking Lot located on 36th Avenue to Lobby Entry Door :							
3	*208.2.4, At least one van accessible parking space must be provided for every 6 accessible parking spaces.	There are an approximate total of 48 spaces in the two parking lots (one of the lots is not fully striped so amount is estimated) . Two (2) accessible spaces are required and provided. Therefore, at least one(1) must be van accessible. However, no van spaces are provided.	6849	Restripe one of the existing handicap spaces and one of the standard spaces to provide for a van accessible space. Create an eight (8) foot wide van accessible space with an eight (8) foot wide access aisle. Provide new van accessible signage.	1	\$1,525		
4	208, 502.4 Parking spaces and access aisle cannot slope more than 2% in any direction.	A significant portion of the accessible parking spaces and access aisles in the front lot have a slope of 8.1%.	6845, 6846	Install new 2" asphalt topping over two (2) accessible spaces in the parking lot with a maximum slope and cross slope of 2%.	1	\$1,440		
5	206.1, 405.8 Accessible route cannot have a cross slope that is more than 2%.	A significant portion of the accessible route from the accessible parking spaces through the front parking lot has a cross slope of 7.1%.	6837, 6838	Provide an accessible route from the accessible parking spaces to the sidewalk. Provide new asphalt topping 5' wide at the top of the existing parking spaces with a slope of no more than 5% and a cross slope no more than 2% . Restripe 5 standard spaces and provide wheel stops.	1	\$3,975		
6	206.1, 403.3 Accessible route cannot slope more than 8.33% and cannot slope more than 5% without having ramp features.	At the sidewalk leading from the parking lot to the lobby entry door, the slope is between 6.1% and 7.2% at several portions of the sidewalk.	6827, 6828, 6831, 6832, 6835, 6836	Regrade and reconstruct portions of the concrete sidewalk to the lobby to have a maximum slope of 5%.	1	\$2,640		
7	Exterior Accessible Route from Sidewalk to Front Door:							
8	207.1, 406.1 Slope of curb ramp cannot exceed 8.33%.	The curb ramp at the entry porch has a slope of 17.1%.	7012, 7013	Rebuild ramp as a Type B curb ramp with new landing parallel to existing door stoop. Remove existing curb ramp.	1	\$4,100		
9	206.5, 404.2.4.4 Maneuvering space at the door cannot slope more than 2%.	The maneuvering space outside the entry door has a slope of 3.0%.	2784, 2785	Rebuild concrete stoop at entry door to have a slope and cross slope no more than 2%.	1	\$3,600		
10	Lobby and Vestibule							

Note: Item numbers indicated in red, are keyed to the aerial site map for the facility. The aerial site map is on the first page of each facility section.

St. Matthew's Church - Ward 4 Voting Location - Hyattsville Transition Plan

Address: 5601 36th Street

	2010 Standards Citation	Description/Issue/Requirement	Non-Complying Item	Photos	Proposed Solution	Suggested Priority	Projected Cost Hyattsville	Projected Date	Action and Date
11	206.5, 404.2.9	Common use interior doors that are required for passage must be operable with no more than 5 pounds force.	The exterior doors in the vestibule, with closers, require greater than 26 pounds force.		Adjust door closer back check and pressure or replace closer.	1	\$615		
12	206.5, 404.2.6	The distance between two doors in a series must be at least 48" beyond the swings of the doors.	At the entry door vestibule, the distance between edge of the open interior door and the surface of the closed exterior door is only 30" wide.		Keep interior vestibule doors held open when voting occurs	5	\$0		
13		Multipurpose room (Voting Location):							
14	206.5, 404.2.9	Common use interior doors that are required for passage must be operable with no more than 5 pounds force.	The doors to the Multipurpose Room require 8 pounds force to operate.		Keep a pair of sanctuary entry doors held open when voting occurs	5	\$0		
15	206.5, *404.2.3	In existing construction where it is technically feasible to widen the doorway, doorways must have a minimum clear opening of 32" when the door is open 90 degrees.	In the Multipurpose Room entry doors, the clear opening of a single door in the pair of doors is 27 1/2". (A single door is held open during voting)	2813, 2814	Keep the pair of sanctuary entry doors held open when voting occurs	5	\$0		
16					Total		\$17,895		
17									
18					Priority 1 - 4:		\$17,895		
19					Priority 5 - 9:		\$0		
20					Priority 10 - 14:		\$0		
21					Priority 15 - 19:		\$0		
22					Priority 20 - 25:		\$0		
23					Total		\$17,895		

Note: Item numbers indicated in red, are keyed to the aerial site map for the facility. The aerial site map is on the first page of each facility section.